

**OCXO SERIES 8000**

Rev. B

■ **FEATURES**

**Small OCXO in 1” SQ. package**  
**Frequencies up to 38.880 MHz**  
**AT and SC-Cut option**

■ **ELECTRICAL PERFORMANCE**


PARAMETER	OCXO SERIES 8000	
	AT CUT CRYSTAL	SC CUT CRYSTAL
Supply voltage, nom.	5V ±5% Standard (3.3V, 12V Optional)	
Power dissipation steady state	1.5 Watt Max.	
Heat up power	3 Watt Max	
Heat up time.	3 min Max	
Frequency range	1 To 38.880 MHz Standard	
Frequency Adjustment	±10PPM Min (0 to 5V)	±0.7PPM Min (0 to 5V)
Freq. stability vs. temperature LX: 0°C to 60°C FZ: -30°C to 70°C D3: -40°C to 85°	±0.05 PPM ±0.1 PPM ±0.25 PPM	±0.01 PPM ±0.02 PPM ±0.03 PPM
	(Standard, contact factory for different temp ranges and stabilities)	
Freq. stability vs. supply changes	±0.015 PPM Max for ±5% Change	±0.010 PPM Max for ±5% Change
Freq. stability vs. load changes	±0.01 PPM Max for ±5% Change	±0.005 PPM Max for ±5% Change
Long term stability (Aging)	±4 PPM Max for 10 Years ±0.005 PPM/Day Max.	±1 PPM Max for 10 Years ±0.002 PPM/Day Max.
Output	HCMOS/TTL/Sine 0 to +7dBm (Low voltage CMOS Available)	
Harmonics, Sub Harmonics	-30dBc(Sine Output)	
Spurious	-75dBc(Sine Output)	
Duty cycle	40/60% to 60/40%(HCMOS)	
Rise / fall time	10nS Max. (HCMOS, 10%~90%Vout, 90%~10%Vout)	
Short term Stability (10MHz)	1 E-10 /Sec	5 E-11 /Sec
Phase Noise typical under static condition (Sine Output 10MHZ)	Offset      Phase Noise 10Hz      -90 dBc/Hz 100Hz     -125 dBc/Hz 1000Hz   -135 dBc/Hz 10000Hz  -150 dBc/Hz	Offset      Phase Noise 10Hz      -110 dBc/Hz 100Hz     -130 dBc/Hz 1000Hz   -140 dBc/Hz 10000Hz  -150 dBc/Hz

Note: All Typical parameters for a 10MHz output and 5V Supply, for different frequencies consult factory

## ■ HOW TO ORDER (PART NUMBER)

Prefix	Output Type	Cut Type	Series	Revision	Temperature Range	Stability	Frequency	Supply Voltage
OX	2:HCMOS 4:LVCMOS 6:SINE	0:AT (No Vcontrol ) 1: SC (No Vcontrol ) 4: AT (Elect Vcontrol) 5: SC (Elect Vcontrol)	80:8000	A	First letter Lowest Temperature, Second letter Highest Temperature: From A=-55°C to Z=+70°C, Then: 1=+75°C, 2=+80°C, 3=+85°C... in 5°C steps Example: LZ: +0°C to +70°C LX: +0°C to +60°C FZ: -20°C to +70°C FZ: -30°C to +70°C D3: -40°C to +85°C	Value x 10E-2 in PPM  Example  28= 0.28PPM  10= 0.1PPM	In MHZ	12:12V 5; 5V 3.3; 3.3V

Example:

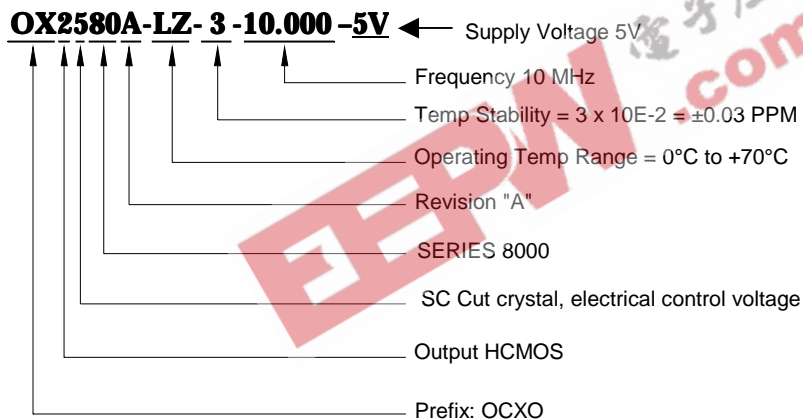

## ■ MECHANICAL SPECIFICATION

